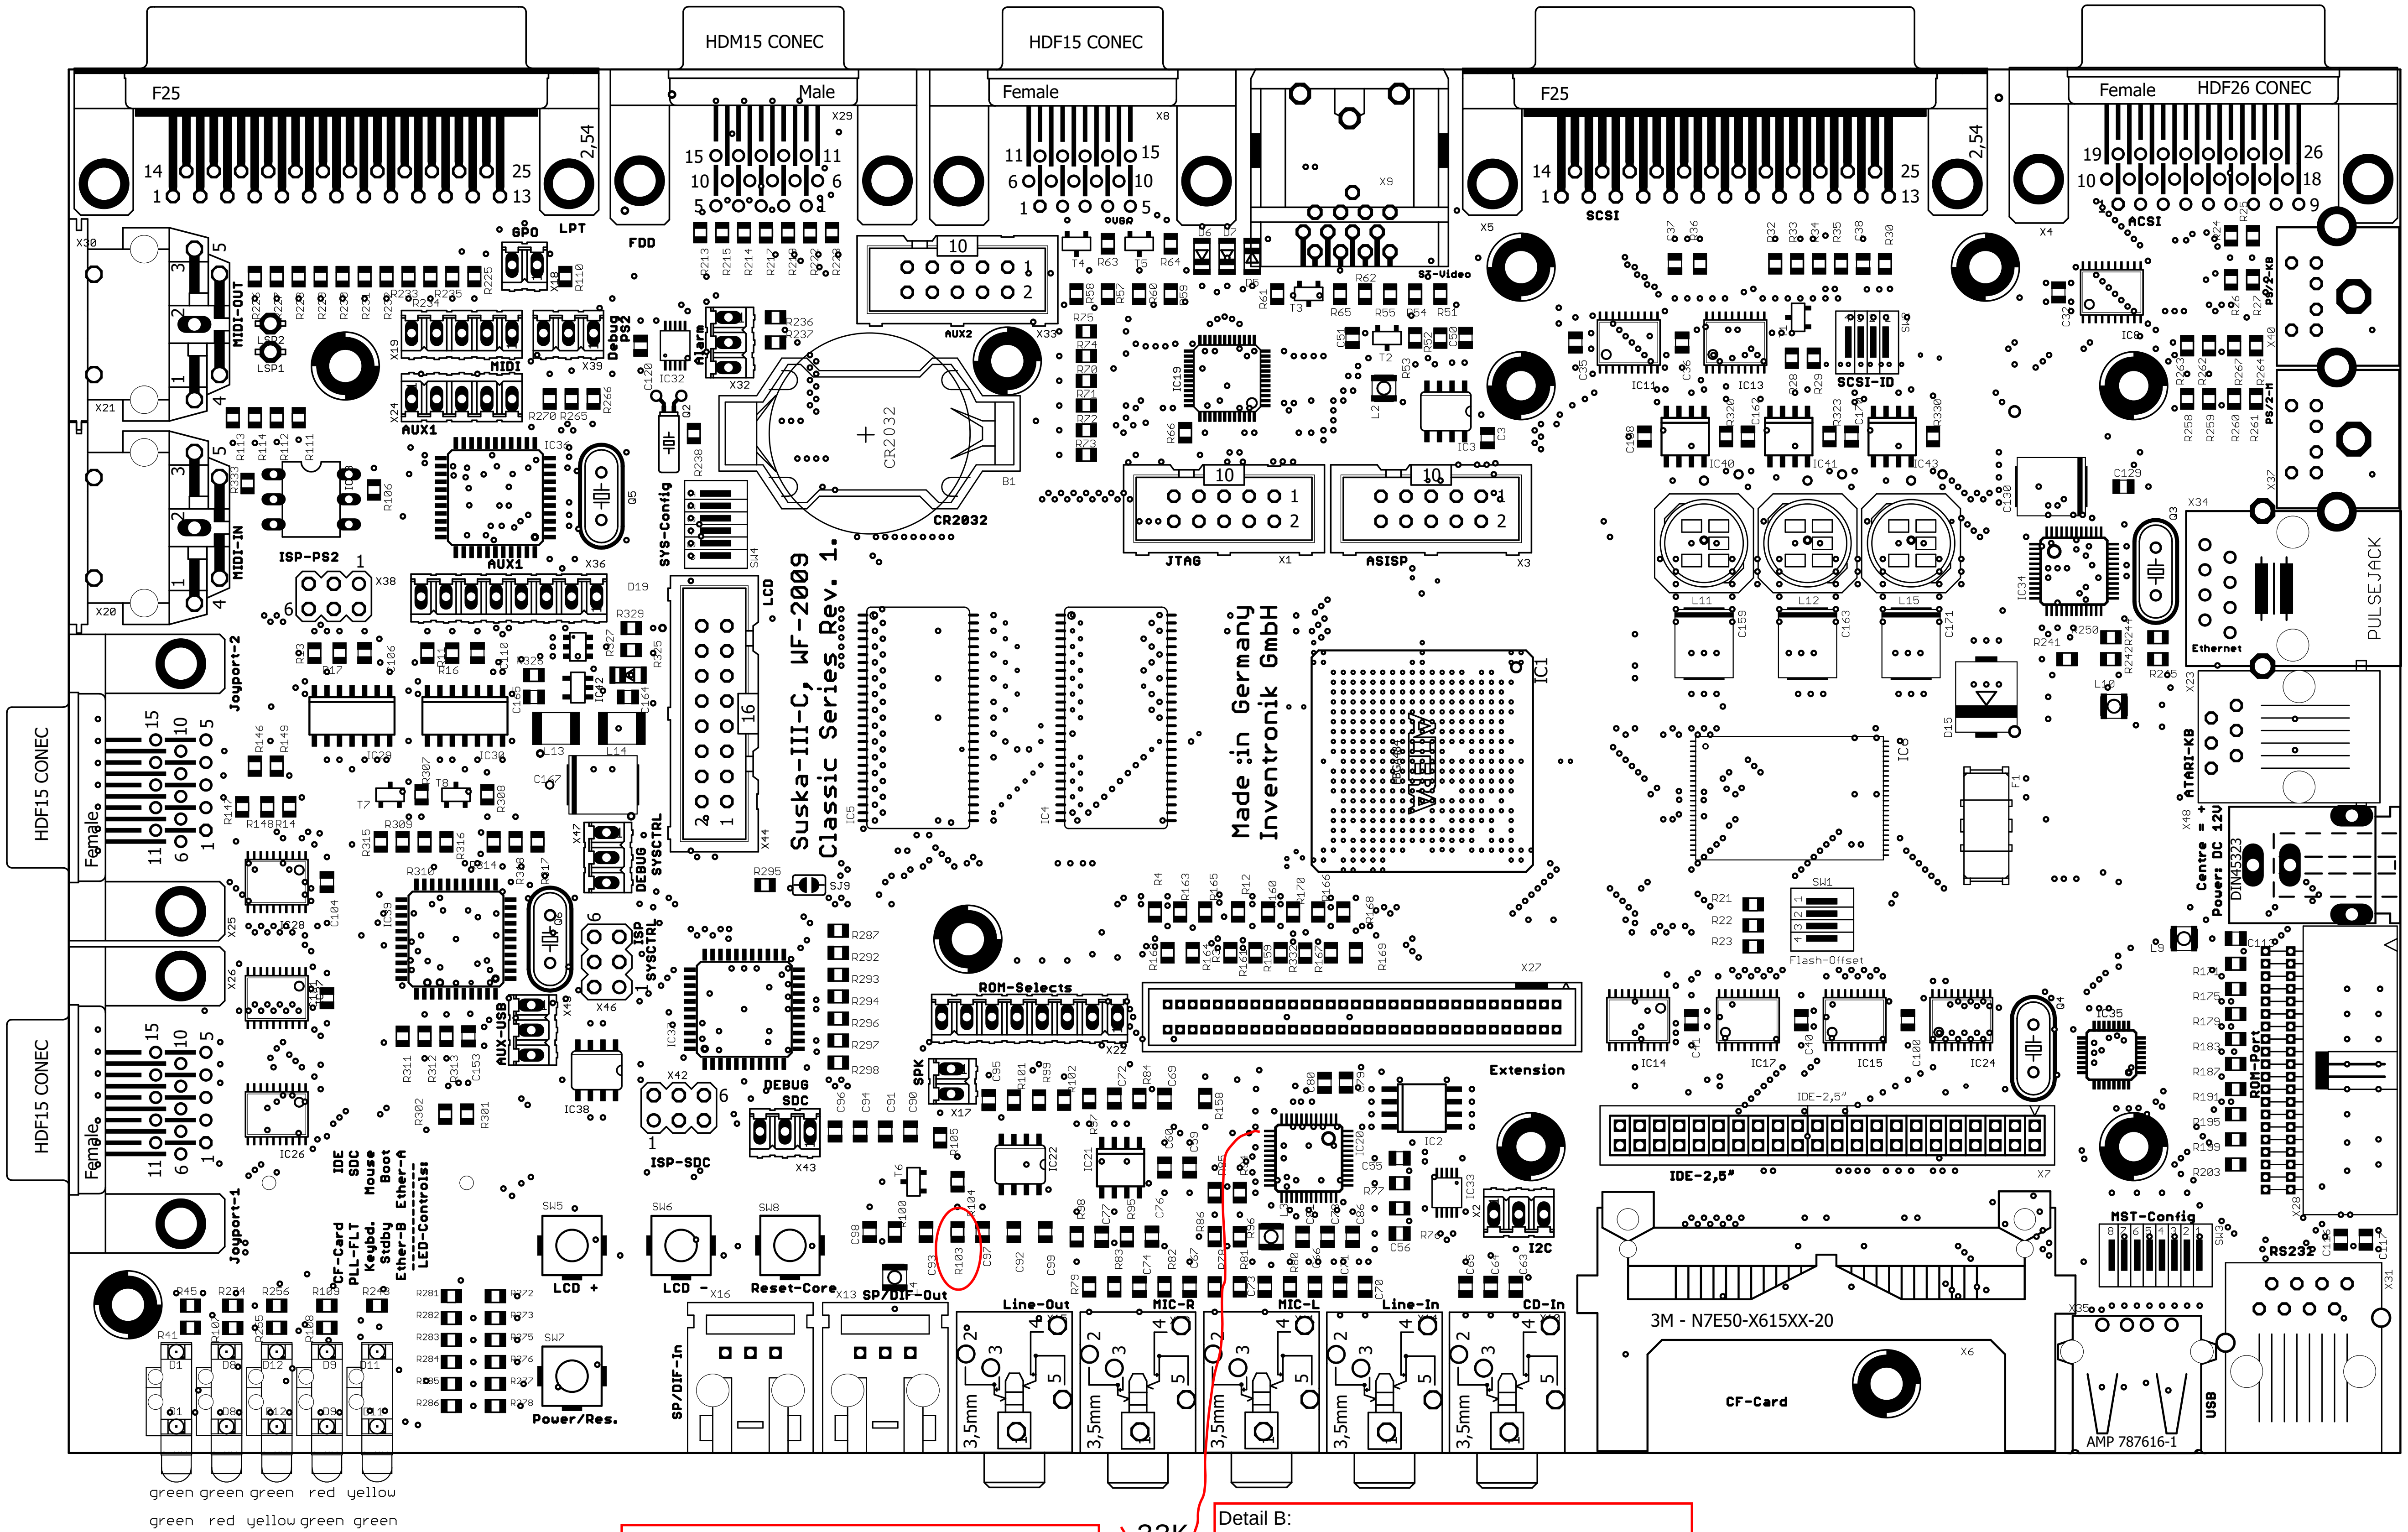

33K
68K

Detail A:
replace R103 by a series connection of a 33K resistor against ground and a 68K resistor against C92.

Detail B:
disconnect pin 13 of the CODEC (IC 20) from the PCB and connect it to the center of the resistors.